The indoor unit is working but the outdoor isn't.

The following procedure should only be attempted by a F-gas trained refrigeration engineer with essential electrics qualifications
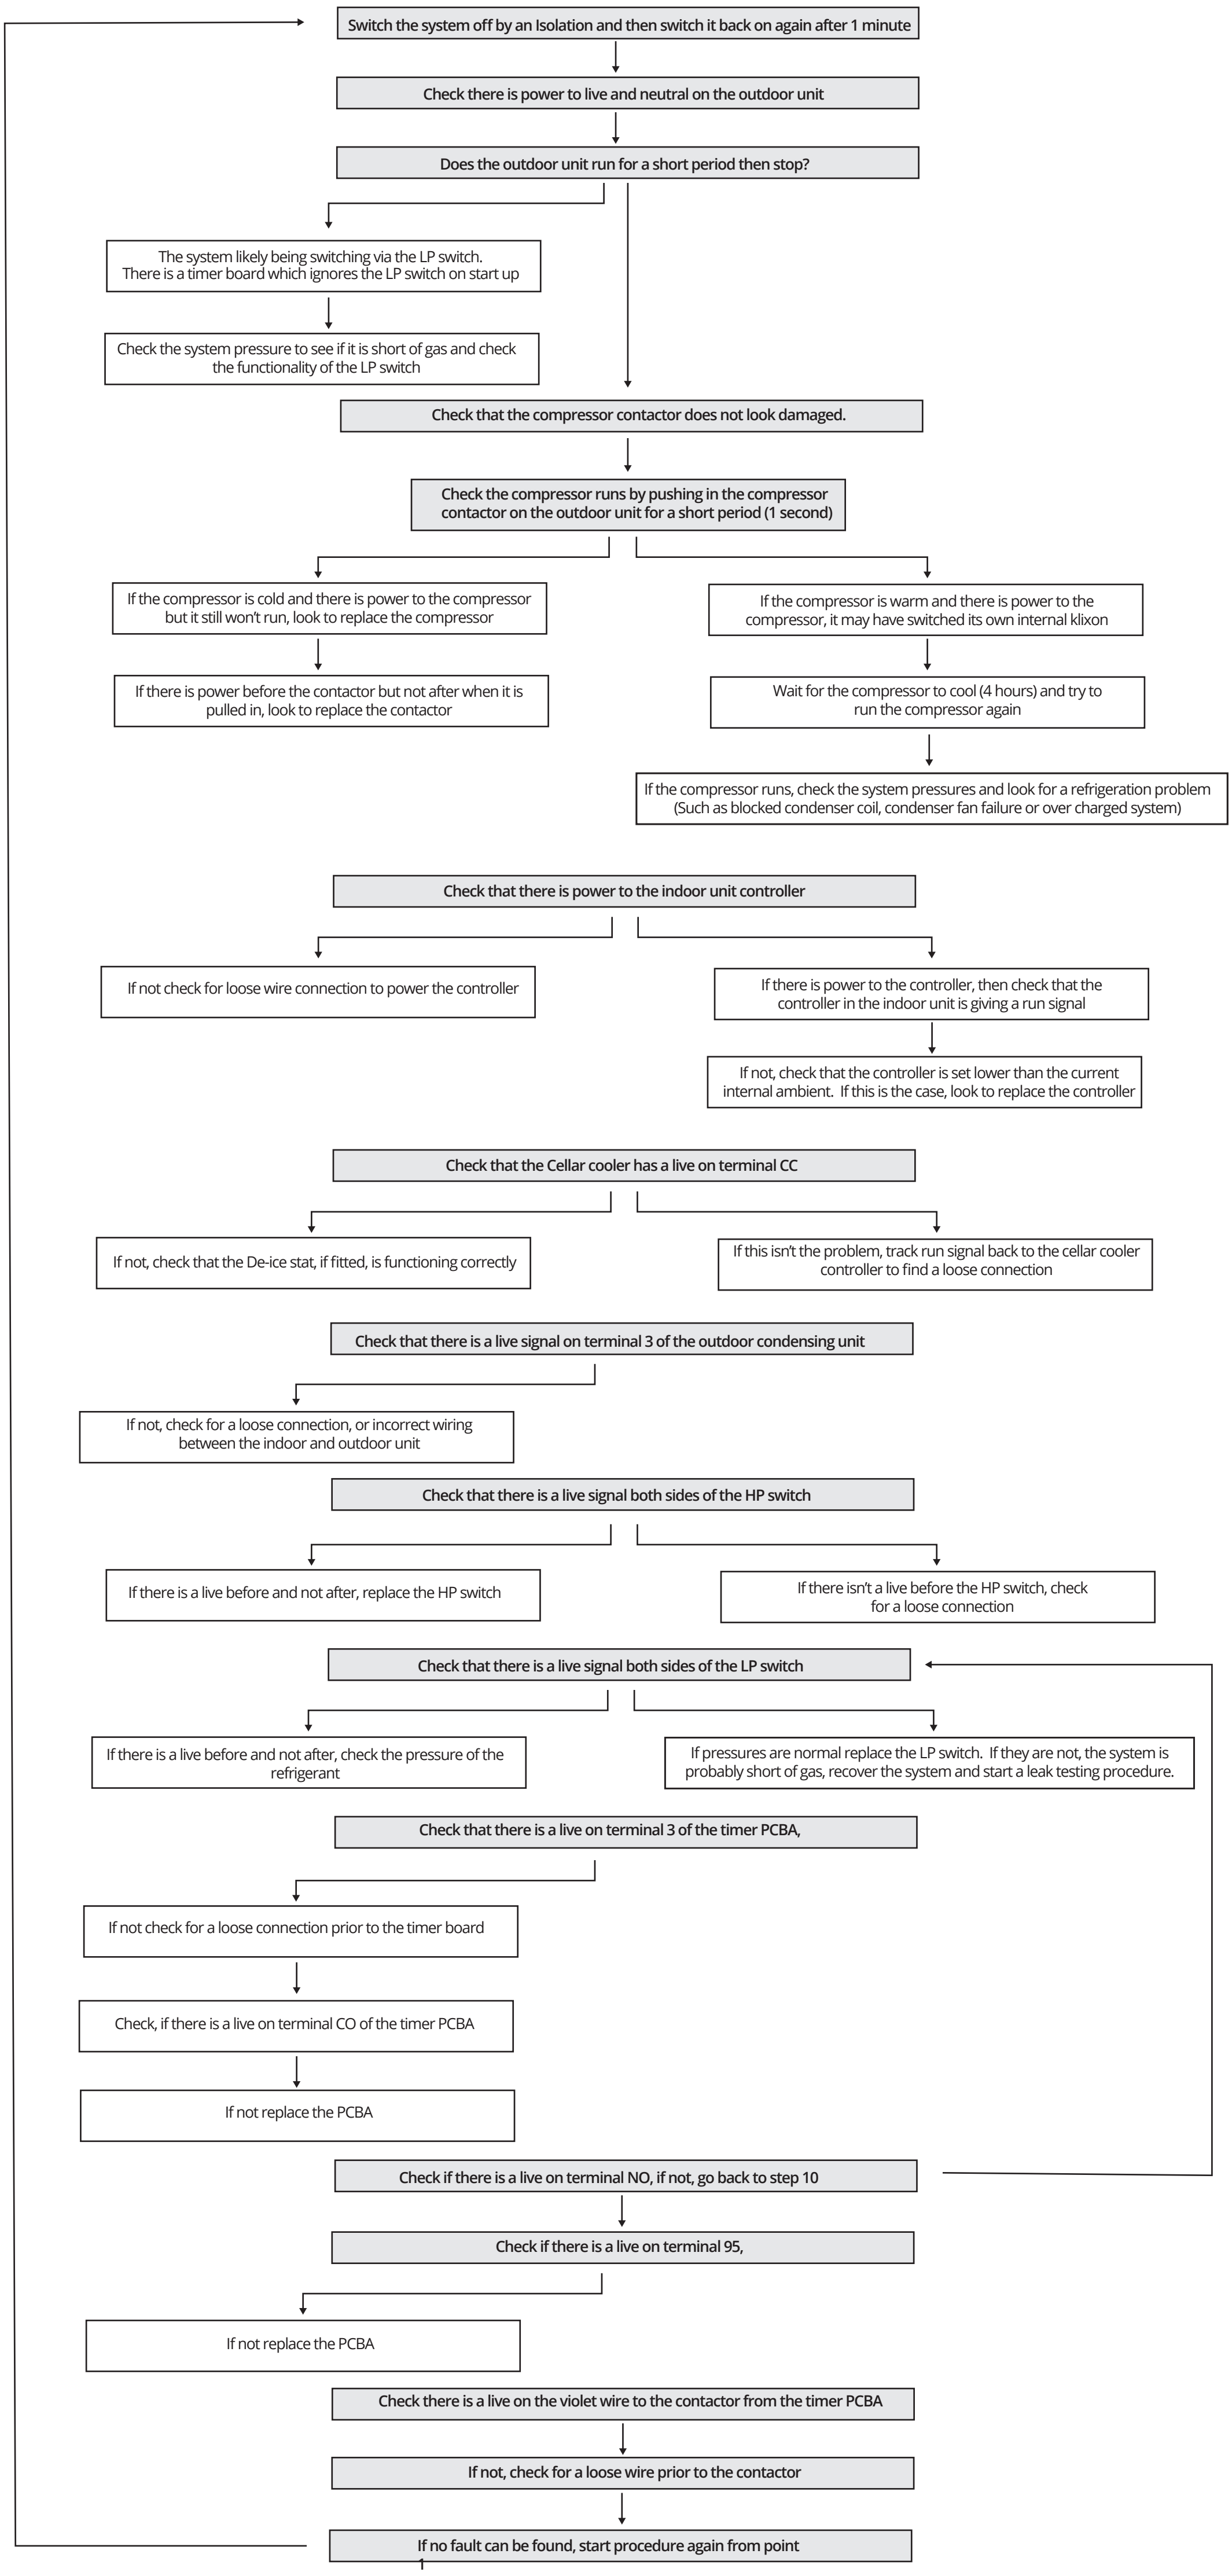
CKC systems